

FAG




HCM7010-E-T-P4S-UL-XL

High speed spindle bearing

High speed spindle bearing HCM70..-E,
adjusted, in pairs or sets, contact angle $\alpha = 25^\circ$, with ceramic balls, restricted tolerances

X-life

Informacje techniczne

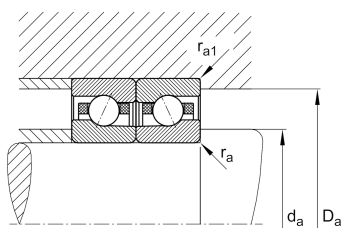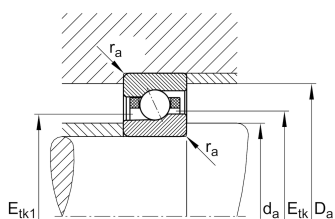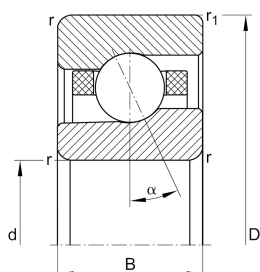

Twoja aktualna wersja produktu

Preload class	L	Preload light
Contact angle	E	Contact angle 25°
Sealing	Without	Not sealed
Cage	T	Laminated fabric cage
Tolerance class	P4S	Tolerance class P4S, FAG standard better than P4 to ISO 492:2023
Arrangement bearing set	U	Single bearing

Main Dimensions & Performance Data

d	50 mm	Bore diameter
D	80 mm	Outside diameter
B	16 mm	Width
C_r	12.500 N	Basic dynamic load rating, radial
C_{0r}	6.700 N	Basic static load rating, radial
C_{ur}	540 N	Fatigue load limit, radial
n_G Grease	30.000 1/min	Limiting speed for grease lubrication
n_G Oil	43.000 1/min	Limiting speed for oil lubrication
$\approx m$	256,56 g	Masa



Mounting dimensions

d _a	56 mm	Diameter shaft shoulder
d _a	h12	Diameter shaft shoulder clearance
D _a	74 mm	Shoulder diameter outer ring
D _a	H12	Shoulder diameter outer ring clearance
r _{a max}	1 mm	Maximum recess radius
r _{a1 max}	0,3 mm	Maximum recess radius
E _{tk min}	61,2 mm	Minimum diameter injection pitch
E _{tk max}	63 mm	Maximum diameter injection pitch
E _{tk1 min}	58,8 mm	Minimum diameter injection pitch
E _{tk1 max}	63 mm	Maximum diameter injection pitch
a	23,2 mm	Distance between the apexes of the pressure cones

Dimensions

r _{min}	1 mm	Minimum chamfer dimension
r _{1 min}	0,6 mm	Minimum chamfer dimension
α	25 °	Contact angle

Temperature range

T _{min}	-30 °C	Operating temperature min.
T _{max}	100 °C	Operating temperature max.



Additional information

F_{VL}	79 N	Preload force light
F_{VM}	206 N	Preload force medium
F_{VH}	429 N	Preload force heavy
K_{aEL}	225 N	Lift-off force light
K_{aEM}	596 N	Lift-off force medium
K_{aEH}	1.257 N	Lift-off force heavy
c_{aL}	92 N/ μ m	Axial rigidity light
c_{aM}	129 N/ μ m	Axial rigidity medium
c_{aH}	169 N/ μ m	Axial rigidity heavy

Właściwości

- 

Obciążenie promieniowe
- 

Obciążenie osiowe jednokierunkowe
- 

Smarowanie smarem
- 

Smarowanie olejem
- 

Bez uszczelnienia